

# Accessibility Evaluation

## Monroe County Polling Location



**Souls Harbor Church**  
**7510 S Old State Rd 37**  
**Bloomington, IN 47403**

**Inspection Date: 03/16/2026**  
**Inspectors: Michael Bird**

Prepared By  
**Monroe County**  
**(916) 473 - 9444**

**Report Date: 04/07/2026**

## ***Table of Contents***

---

<b>Findings</b>	.....	<b>3</b>
<b>Exterior</b>	.....	<b>3</b>
<b>Parking</b>	.....	<b>3</b>
<b>Path of Travel</b>	.....	<b>4</b>
<b>Interior</b>	.....	<b>6</b>
<b>Restrooms</b>	.....	<b>6</b>

## Exterior: Parking

### Finding: 1

The required parking signage is missing.

Parking space identification signs shall include the International Symbol of Accessibility (ISA). Signs identifying van parking spaces shall contain the designation "van accessible." All signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.

*2010 ADAS Section 502.6*


*Parking space identification signs shall include the International Symbol of Accessibility complying with 703.7.2.1. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches (1525 mm) minimum above the finish floor or ground surface measured to the bottom of the sign.*

### Citation:

2010 ADAS Section: 502.6

### Recommendation:

The four accessible spaces have no signage. Recommend adding temporary or permanent signs.

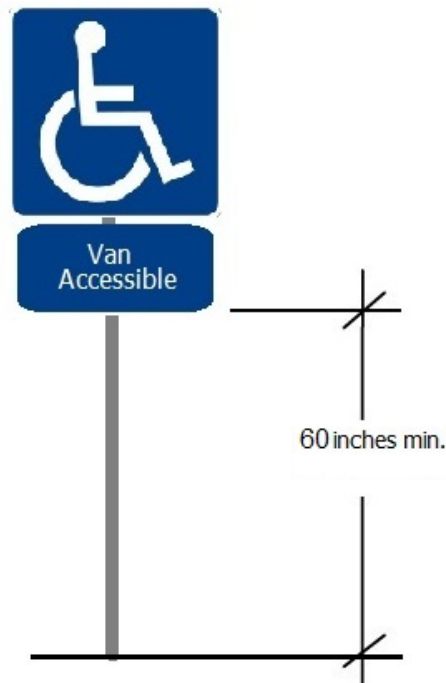

## Exterior: Path of Travel

### Finding: 2

The ramps contains multiple issues.

The ramp contains running slopes greater than 8.3% and 2% cross slope.

The ramp does not have compliant level landings.

The ramp is not the required minimum width.

The ramp does not have compliant handrails with wheel guides.

The ramp surface contains changes in level.

*2010 ADAS Section 405.1*


*Ramps on accessible routes shall comply with 405*

### Citation:

2010 ADAS Section: 405.1

### Recommendation:

The ramp has no railings and individuals must travel through the path of traffic to reach it. Recommend adding signage directing voters to the front doors as an alternate accessible entry.

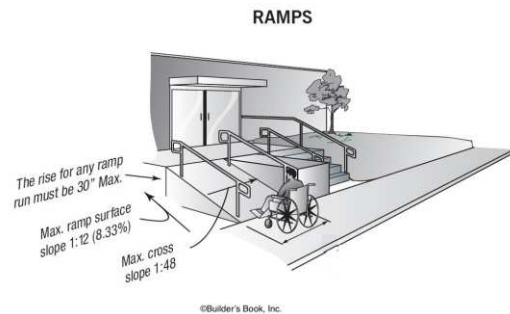

**Finding: 2 Additional Finding Photos**



## Interior: Restrooms

### Finding: 3

The restroom is not compliant.

The restroom may have some or all of the following problems: The restroom does not have the required minimum clear floor space or maneuvering clearances for the toilet. The restroom does not have the required minimum clear floor space or maneuvering clearances for the lavatory. The entry door does not contain the required minimum maneuvering spaces on the pull/push sides. The entry door encroaches into the required clear floor space for fixtures. Grab bars are missing and/or incorrectly installed. Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both. The restroom contains floor level changes greater than a 1/2 inch of the floor drains and is slope (XX) - (XX), the shower is too small and missing numerous accessible elements.

2010 ADAS Section 213.2

Where toilet rooms are provided, each toilet room shall comply with 603. Where bathing rooms are provided, each bathing room shall comply with 603.

### Citation:

2010 ADAS Section: 213.2

### Recommendation:

Place signage informing voters that accessible restrooms are not available and directing voters with disabilities to the front of the line. Alternatively, place an accessible portable restroom outside.

