

# Accessibility Evaluation

## Monroe County Polling Location



**Bloomington High School South**  
**1965 S Walnut St**  
**Bloomington, IN 47401**  
**Accessibility Evaluation**  
**Inspection Date: 03/06/2026**  
**Inspectors: Chris Jackson**

Prepared By  
**Monroe County**  
**(916) 473 - 9444**

**Report Date: 03/10/2026**

## ***Table of Contents***

---

<b>Findings</b>	.....	<b>3</b>
<b>Exterior</b>	.....	<b>3</b>
<b>Parking</b>	.....	<b>3</b>
<b>Interior</b>	.....	<b>7</b>
<b>White Gym Auxiliary Restrooms</b>	.....	<b>7</b>

## **Exterior: Parking**

### **Finding: 1**

**Spaces South of Door:** The van space is missing the required van identification sign.

**Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."**

*2010 ADAS Section 502.6*


*Parking space identification signs shall include the International Symbol of Accessibility complying with 703.7.2.1. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches (1525 mm) minimum above the finish floor or ground surface measured to the bottom of the sign.*

### **Citation:**

**2010 ADAS Section: 502.6**

### **Recommendation:**

**Add temporary or permanent accessible parking signage to the space without signage. Add temporary or permanent "van accessible" signage to at least one of the four accessible spaces.**

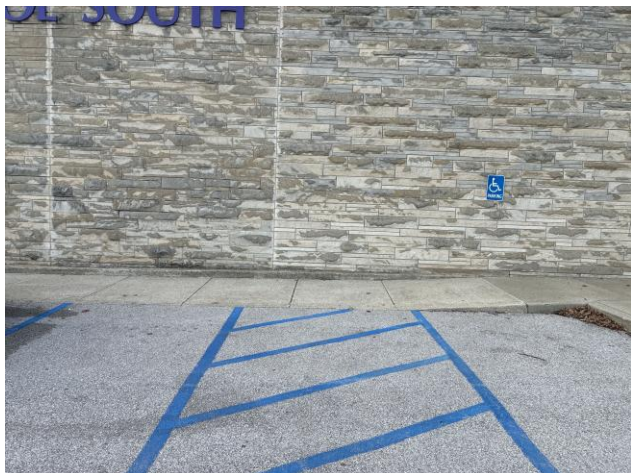

## Exterior: Parking

### Finding: 2

**Spaces North of Door:** The van space is missing the required van identification sign.

**Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."**

*2010 ADAS Section 502.6*

*Parking space identification signs shall include the International Symbol of Accessibility complying with 703.7.2.1. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches (1525 mm) minimum above the finish floor or ground surface measured to the bottom of the sign.*

### Citation:

**2010 ADAS Section: 502.6**

### Recommendation:

Add temporary or permanent "van accessible" signage to at least one of the four accessible spaces.



## Exterior: Parking

### Finding: 3

The access aisle is not located on an accessible route of travel to the accessible building entrance.

Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from parking to an accessible entrance. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances.

#### 2010 ADAS Section 208.3.1

Parking spaces complying with 502 that serve a particular building or facility shall be located on the shortest accessible route from parking to an entrance complying with 206.4. Where parking serves more than one accessible entrance, parking spaces complying with 502 shall be dispersed and located on the shortest accessible route to the accessible entrances. In parking facilities that do not serve a particular building or facility, parking spaces complying with 502 shall be located on the shortest accessible route to an accessible pedestrian entrance of the parking facility.

#### 2010 ADAS Section 502.3


Access aisles serving parking spaces shall comply with 502.3. Access aisles shall adjoin an accessible route. Two parking spaces shall be permitted to share a common access aisle.

### Citation:

2010 ADAS Section: 208.3.1, 502.3

### Recommendation:

Add cones to create a 36" wide protected path of travel along the sidewalk by the curb cut. This will also prevent vehicles from parking in front of the curb cut, even temporarily. (See additional photograph on next page for example cone placement.)

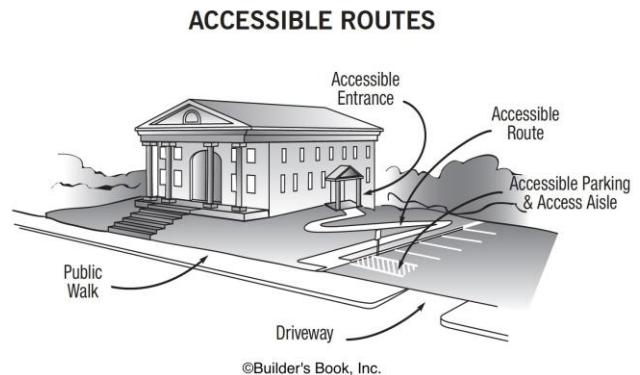

**Finding: 3 Additional Finding Photos**



## **Interior: White Gym Auxiliary Restrooms**

### **Finding: 4**

**There are not enough accessible toilet compartments. Where toilet compartments are provided, at least one toilet compartment shall be wheelchair accessible.**

**The room contains 4 toilet compartments. A minimum of one must be wheelchair accessible .**

*2010 ADAS Section 213.3.1*

*Where toilet compartments are provided, at least one toilet compartment shall comply with 604.8.1. In addition to the compartment required to comply with 604.8.1, at least one compartment shall comply with 604.8.2 where six or more toilet compartments are provided, or where the combination of urinals and water closets totals six or more fixtures.*

### **Citation:**

**2010 ADAS Section: 213.3.1**

### **Recommendation:**

**The restrooms across from the White Gym are inaccessible and will likely be locked as they are not frequently used. Add signage directing voters to the accessible restrooms by the entry doors.**

**Consider removing the signs with accessible symbols from the auxiliary restrooms, since they are not actually accessible.**

