

Accessibility Evaluation

Monroe County Polling Location



Jackson Creek Middle School
3980 S Sare Rd
Bloomington, IN 47401

Inspection Date: 04/16/2026
Inspectors: Michael Bird

Prepared By
Monroe County
(916) 473 - 9444

Report Date: 04/20/2026

Table of Contents

Findings	3
Exterior	3
Parking	3
Interior	5
Restrooms	5

Exterior: Parking

Finding: 1

There are three possible entrances, only one of which will lead to the voting area.

2010 ADAS Section 216.6

Where not all entrances comply with 404, entrances complying with 404 shall be identified by the International Symbol of Accessibility complying with 703.7.2.1. Directional signs complying with 703.5 that indicate the location of the nearest entrance complying with 404 shall be provided at entrances that do not comply with 404.

Citation:

2010 ADAS Section: 216.6

Recommendation:

Place temporary signage directing voters to the correct entrance.



Exterior: Parking

Finding: 2

The accessible parking is located at a significant distance from the entrance.

Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from parking to an accessible entrance. Where parking serves more than one accessible entrance, accessible parking spaces shall be dispersed and located closest to the accessible entrances.

2010 ADAS Section 208.3.1


Parking spaces complying with 502 that serve a particular building or facility shall be located on the shortest accessible route from parking to an entrance complying with 206.4. Where parking serves more than one accessible entrance, parking spaces complying with 502 shall be dispersed and located on the shortest accessible route to the accessible entrances. In parking facilities that do not serve a particular building or facility, parking spaces complying with 502 shall be located on the shortest accessible route to an accessible pedestrian entrance of the parking facility.

Citation:

2010 ADAS Section: 208.3.1

Recommendation:

Recommend using cones and temporary signage to create several angled accessible parking spaces and access aisles in the bus drop-off lane.

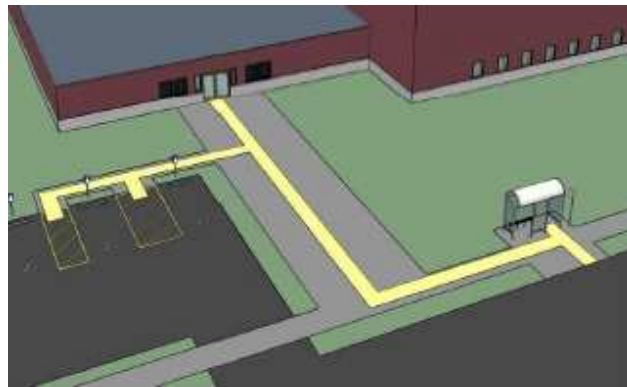

Interior: Restrooms

Finding: 3

The restrooms are located in a different hallway than the voting area.

2010 ADAS Section 216.8

Where existing toilet rooms or bathing rooms do not comply with 603, directional signs indicating the location of the nearest toilet room or bathing room complying with 603 within the facility shall be provided. Signs shall comply with 703.5 and shall include the International Symbol of Accessibility complying with 703.7.2.1. Where existing toilet rooms or bathing rooms do not comply with 603, the toilet rooms or bathing rooms complying with 603 shall be identified by the International Symbol of Accessibility complying with 703.7.2.1. Where clustered single user toilet rooms or bathing facilities are permitted to use exceptions to 213.2, toilet rooms or bathing facilities complying with 603 shall be identified by the International Symbol of Accessibility complying with 703.7.2.1 unless all toilet rooms and bathing facilities comply with 603.

Citation:

2010 ADAS Section: 216.8

Recommendation:

Recommend adding a temporary or permanent sign that indicates the direction to the closest accessible restroom and directs voters toward it.

