

Accessibility Evaluation

Monroe County Polling Location



St. John's Catholic Church
4607 W State Rd 46
Bloomington, IN 47404

Inspection Date: 03/12/2026
Inspectors: Chris Jackson

Prepared By
Monroe County
(916) 473 - 9444

Report Date: 04/10/2026

Table of Contents

Findings	3
Exterior	3
Parking	3

Exterior: Parking

Finding: 1

The access aisle is not located on an accessible route of travel to the accessible building entrance.

Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from parking to an accessible entrance. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances.

2010 ADAS Section 208.3.1

Parking spaces complying with 502 that serve a particular building or facility shall be located on the shortest accessible route from parking to an entrance complying with 206.4. Where parking serves more than one accessible entrance, parking spaces complying with 502 shall be dispersed and located on the shortest accessible route to the accessible entrances. In parking facilities that do not serve a particular building or facility, parking spaces complying with 502 shall be located on the shortest accessible route to an accessible pedestrian entrance of the parking facility.

2010 ADAS Section 502.3


Access aisles serving parking spaces shall comply with 502.3. Access aisles shall adjoin an accessible route. Two parking spaces shall be permitted to share a common access aisle.

Citation:


2010 ADAS Section: 208.3.1, 502.3

Recommendation:

No curb cuts at access aisles. Recommend either adding ramps up to sidewalk or using cones to mark a protected path of travel from the parking lot to the portico.

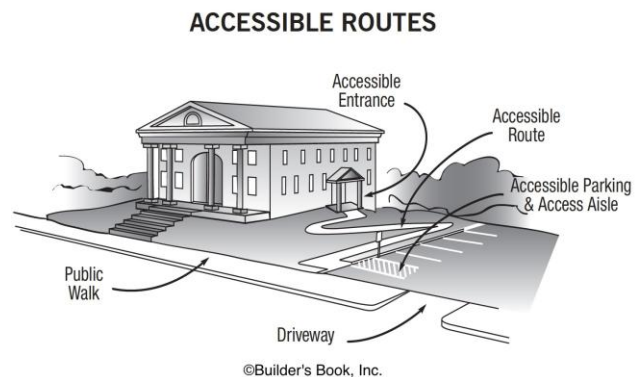

Finding: 1 Additional Finding Photos

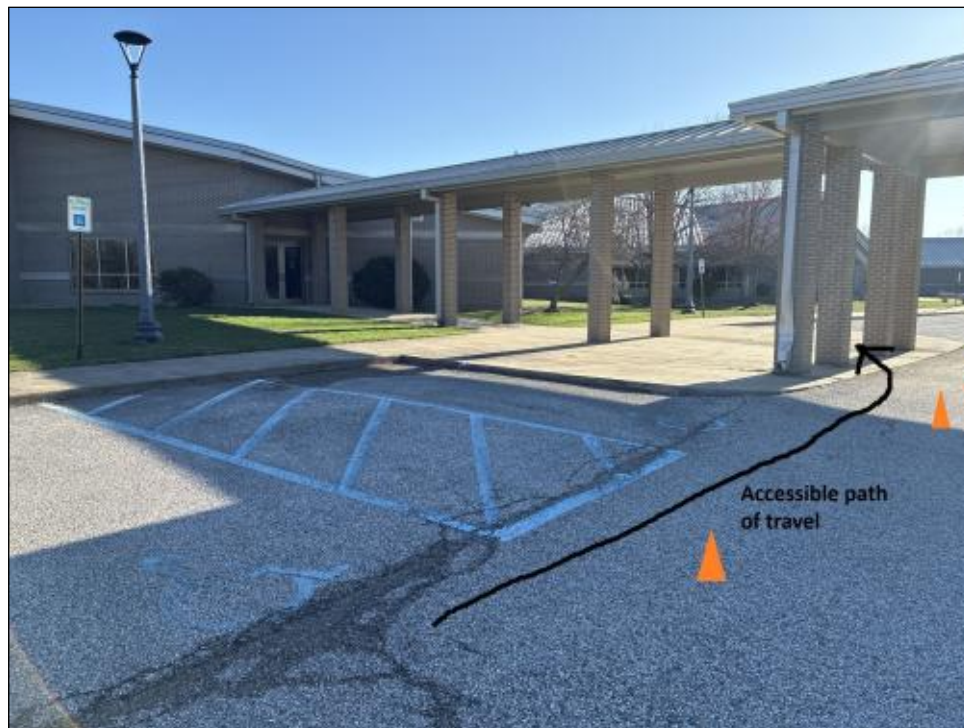

Exterior: Parking

Finding: 2

The van space is missing the required van identification sign.

The accessible space to the left of the portico is the only one that meets van requirements, but it needs a van accessible sign. A second Van space could use the same 8' access aisle but that space, while striped in blue, has no sign at all.

Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."

2010 ADAS Section 502.6

Parking space identification signs shall include the International Symbol of Accessibility complying with 703.7.2.1. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches (1525 mm) minimum above the finish floor or ground surface measured to the bottom of the sign.

Citation:

2010 ADAS Section: 502.6

Recommendation:

Recommend adding temporary or permanent signage.

